

## **EVERGUARD GOLD COPING**


TAPERED VERSION - 2'-0" O.C.

INSTALLATION INSTRUCTIONS


IMPORTANT: PRIOR TO INSTALLATION, READ INSTRUCTIONS CAREFULLY.

NOTE: POSITION ROOF MEMBRANE ON TOP OF THE WALL COVERING THE TREATED WOOD NAILER(S) OR SUBSTRATE COMPLETELY. ALLOW 1/2" MINIMUM EXCESS MEMBRANE BEYOND NAILER WHERE APPLICABLE. NRCA REQUIREMENT.

**CAUTION: INSTALL MITERS FIRST!** 

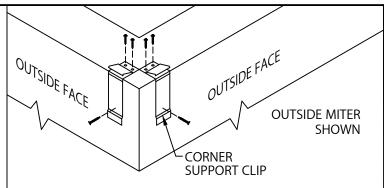



STEP 1 - CORNER SUPPORT CLIPS LOCATE AND FASTEN GALVANIZED CORNER SUPPORT CLIPS TO THE WALL.

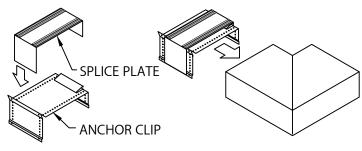


### STEP 2 - MITER SPLICE PLATES & ANCHOR CLIPS

REMOVE RELEASE PAPER FROM SPLICE PLATE SEALANT STRIPS. POSITION THE SPLICE PLATE IN THE CENTER OF THE ANCHOR CLIP. INSTALL THE SPLICE PLATE AND ANCHOR CLIP ASSEMBLY INTO EACH END OF THE CORNER AS SHOWN.

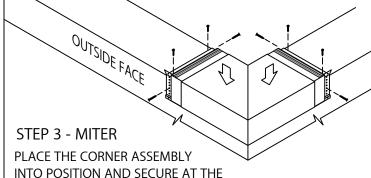

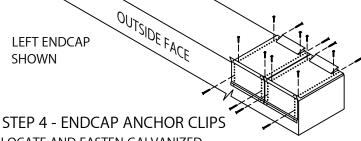

LOCATE AND FASTEN GALVANIZED ANCHOR CLIPS TO WALL WITH PROVIDED FASTENERS FOR SUBSTRATE (SEE DETAIL A).

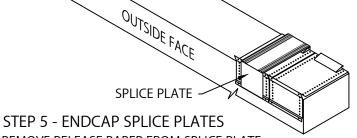


EXPOSED EDGE OF THE ANCHOR CLIPS AS PER DETAIL A.

REMOVE RELEASE PAPER FROM SPLICE PLATE SEALANT STRIPS. PLACE SPLICE PLATE ONTO ANCHOR CLIP AS SHOWN.

#### STEP 6 - ENDCAP

HOOK OUTSIDE FACE OF ENDCAP OVER THE ANCHOR CLIPS AND ROTATE INTO PLACE. ENGAGE REAR LEG ONTO ANCHOR CLIPS BY PRESSING DOWNWARD UNTIL SNAP LOCK OCCURS.

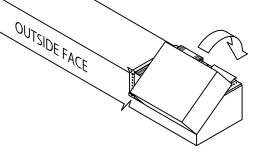



1 CAMPUS DRIVE, PARSIPPANY, NJ 07054 USA 973-628-3000 WWW.GAF.COM DATE: 06/14/22 DRN BY: MLM

SHT.#<u>1</u> OF <u>3</u>

CKD BY: MM DWG# 25111-38675



## EVERGUARD GOLD COPING


TAPERED VERSION - 2'-0" O.C.

**INSTALLATION INSTRUCTIONS** 


#### **INSTALLATION NOTES:**

1) Installing contractor shall check as-built conditions, including nailer attachment, and verify the manufacturer's coping details for accuracy to fit the wall assembly prior to fabrication.


2) Fasteners must be corrosion resistant and rated for a minimum 250# pullout force for the substrate that is being used.

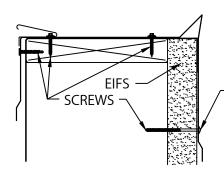

 -If using an EIFS system, fasten through face w/ fastener of proper length to penetrate through EIFS and attach into structural component

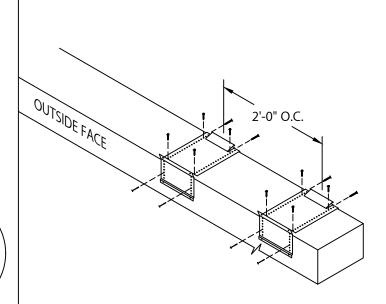


STEP 7 - ANCHOR CLIPS LOCATE OVER MEMBRANE AND FASTEN GALVANIZED ANCHOR CLIPS TO WALL AT 2'-0" ON CENTER WITH PROVIDED FASTENERS AS SHOWN IN DETAIL A.

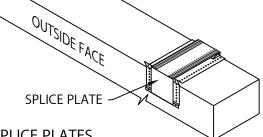

STEP 8 - SPLICE PLATES
PLACE SPLICE PLATE ONTO ANCHOR CLIPS
AT SPLICE JOINTS


NOTE: REMOVE RELEASE PAPER FROM SEALANT STRIPS.

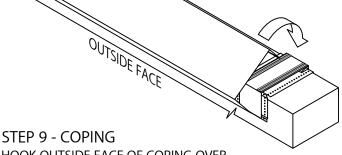

HOOK OUTSIDE FACE OF COPING OVER
THE ANCHOR CLIPS AND ROTATE INTO PLACE. ENGAGE
REAR LEG ONTO ANCHOR CLIPS BY PRESSING DOWNWARD
UNTIL SNAP LOCK OCCURS.

# STEP 10 - COMPLETION

CONTINUE INSTALLING COPING WITH A
3/8" SPACE AT SPLICE JOINTS TO ALLOW FOR
THERMAL EXPANSION. FIELD CUT WHERE
NECESSARY USING FINE TOOTH HACKSAW OR SNIPS.
REMOVE PROTECTIVE FILM IMMEDIATELY.

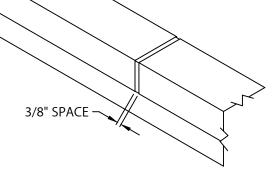



1 CAMPUS DRIVE, PARSIPPANY, NJ 07054 USA 973-628-3000 WWW.GAF.COM DATE: 06/14/22 DRN BY: MLM

CKD BY: MM

SHT.#2 OF 3

DWG# 25111-38675


A



TAPERED VERSION - 2'-0" O.C.

**INSTALLATION INSTRUCTIONS** 

### TYPICAL COPING INSTALLATION **DETAIL A**

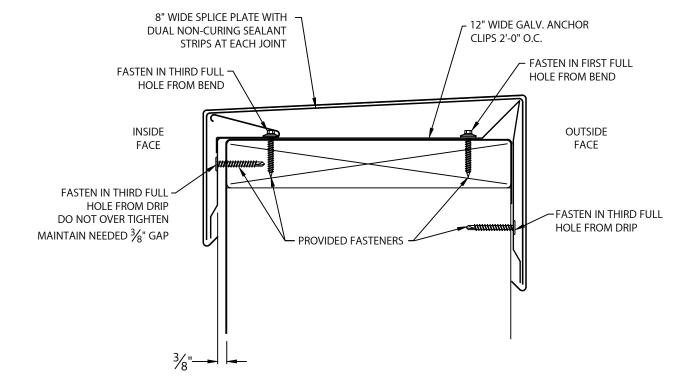



1 CAMPUS DRIVE, PARSIPPANY, NJ 07054 USA 973-628-3000 WWW.GAF.COM

DATE: 06/14/22

DRN BY: MLM CKD BY: MM

SHT.#\_3\_ OF \_3

DWG# 25111-38675