


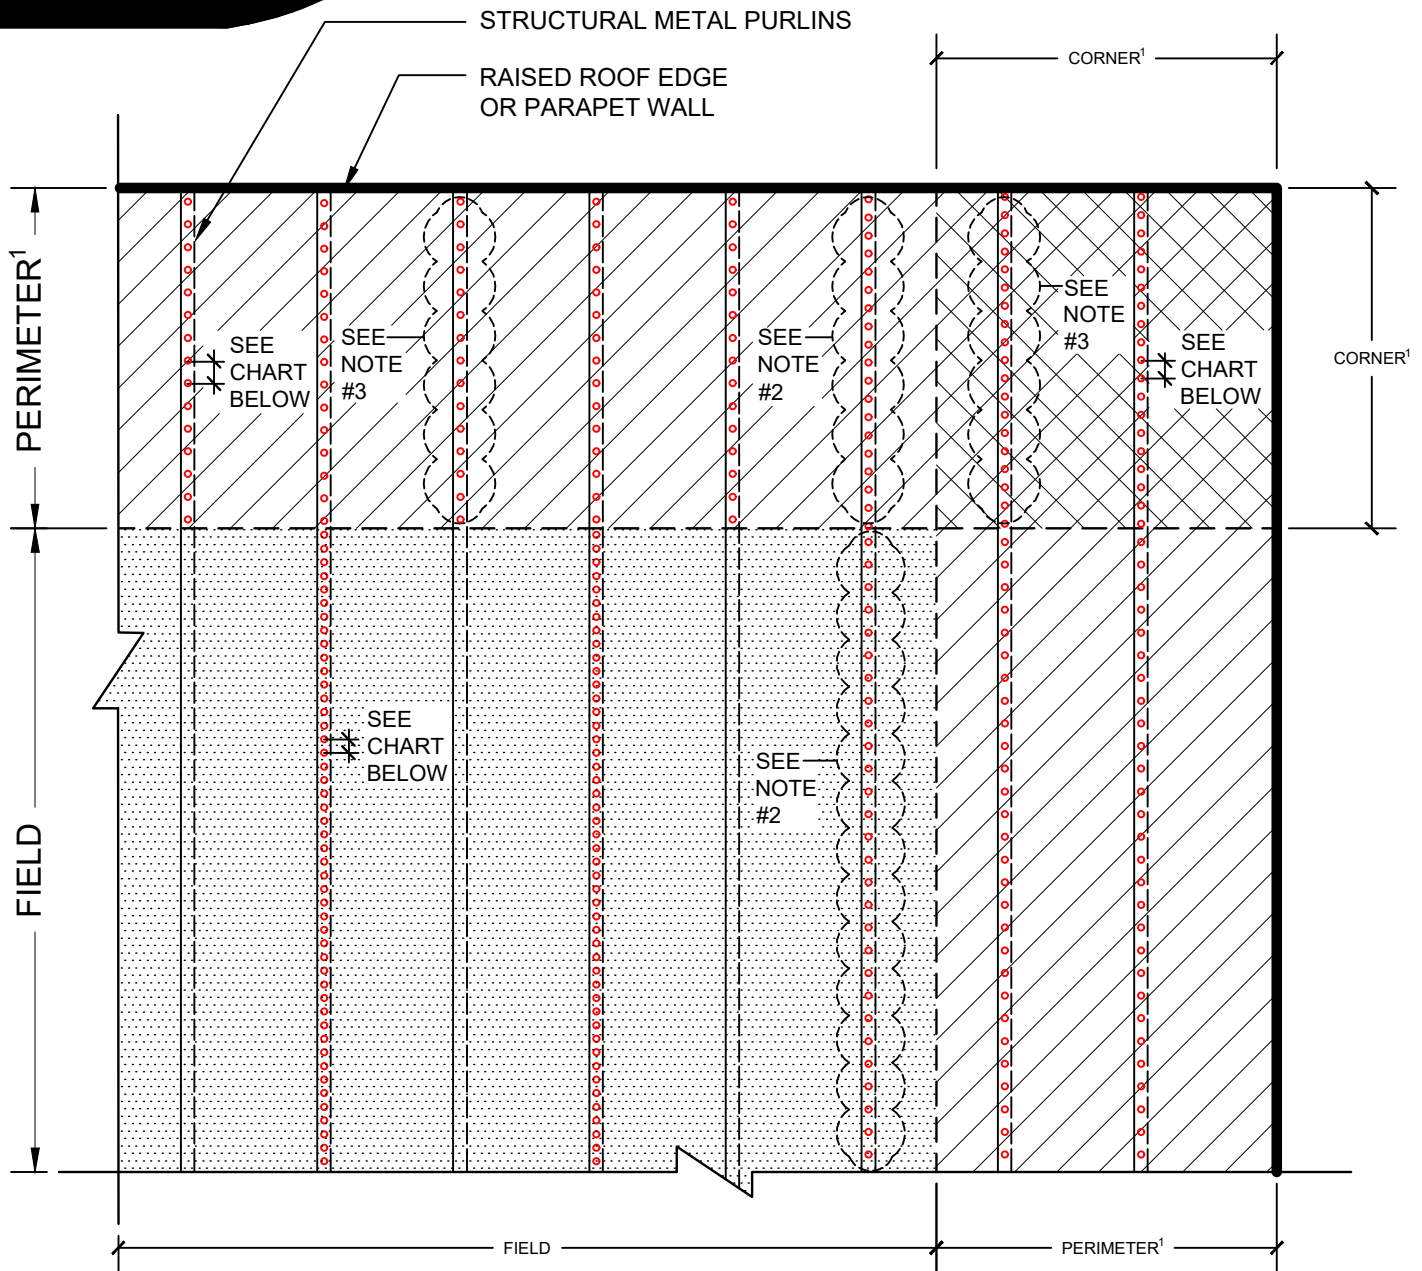

MAXIMUM FASTENER SPACING			
PURLIN TYPE	FIELD ZONE	PERIMETER ZONE	CORNER ZONE
MIN. 16 GA.	6" O.C.	10" O.C.	8" O.C.
MIN. 14 GA.	9" O.C.	12" O.C.	9" O.C.
MIN. 12 GA.	9" O.C.	12" O.C.	9" O.C.

NOTE:

1. SEE EVERGUARD® SPEC MANUAL TO DETERMINE PERIMETER AND CORNER ZONES.
2. DEFAULTS TO PERIMETER FASTENING RATE.
3. DEFAULTS TO CORNER FASTENING RATE.

GAF
EVERY OTHER PURLIN FASTENING ZONES
- MECHANICALLY ATTACHED ASSEMBLY

 DRAWING #
108C

THIS DETAIL APPLIES TO:

MECHANICALLY ATTACHED SYSTEMS

ISSUE / REVISION DATE

8/17/20

SCALE

N.T.S.

LEGEND

- FIELD ZONE
- PERIMETER ZONE
- CORNER ZONE